

Date: Wednesday, 29/10/2008 4:21:23 PM
 User: Julie Dawson

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	SKID TUBE ASSEMBLY
Job Number :	43083		
Estimate Number :	10023		
P.O. Number :		Part Number :	D205634041
This Issue :	29/10/2008	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	D2580 REV D
First Issue :	/ /	Project Number :	N/A
Previous Run :	43082	Drawing Revision :	D
	Type :	Material :	
	SKIDTUBES	Due Date :	10/11/2008
Written By :		Qty:	1 Um: Each
Checked & Approved By :	JLD 08.10.30		
Comment :	Est Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ Est Rev: O 06.02.28 Added paperwork EC Est Rev:P 07-07-09 SS Wearplates & Gaskets JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



for JLD 08.11.14



Comment: DOCUMENT CONTROL
 Photocopy D205-634 bluefile & type labels per PPP D205-634-041 CHG002

Sosulix

2.0	D25001190	Ext'n -1' Beam Tube 4"
-----	-----------	------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
 Pick:

Qty	Part Number	Description	Batch
1	D2500-1-190	Skid Tube Extrusion	B-40150

ALM 8-11-3

3.0	D2596	Web, 205 Skidtube
-----	-------	-------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
 Pick:

Qty	Part Number	Description	Batch
1	D2596	205 Web	B-43108

ALM 8-11-04

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2580 if necessary Deburrr ends

3-Acid etch and Alodine tube per QSI 005 4.1

ALM 8-11-03

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Wednesday, 29/10/2008 4:21:23 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43083

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

D M 8-11-3

6.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

2-Open holes to 0.500" as per Dwg D2580without cutting fluid

3-Countersink holes as per Dwg D2580without cutting fluid

4-Deburr and blow out all chips from inside of tube

5-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 M109449

Sikaflex expire date: 8-11-30

Start Time: 8:50 Date: 8-11-04

Fin Time: 7:00 Date: 8-11-04

AWM 8-11-03

AWM

8-11-04

7.0

BENDING

BENDING MACHINE - SKIDTUBES



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

8-11-05

8.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends

2-Prepare tube for welding, remove alodine as required.

AWM 8-11-05

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/10/2008 4:21:23 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43083

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

BE 8-11-06 05

10.0

D25763

Step (maching detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2576-3	Step	238892

BE 8-11-06 05

11.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
20	D2579	Spacers	B-41432

AWM 8-11-05

20PCS X

12.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

2-Weld step D2576 as per Dwg. D2580 and QSI 004.

A/R

Aluminum Rod

m109213

BE 8-11-05

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

m109213

8-11-05

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

JD 8-11-6

5-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Debur

JD 8-11-6

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Debur holes

7-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

JD 8-11-6

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/10/2008 4:21:23 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43083

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

S 08/10/06 (X)

14.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/10/06 (X)

15.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

FD 08/11/11 (1)

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

2:15
320 OF
2:45

M-L 08/11/12

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-11-13 (X1)

18.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch:

1341340

JS

19.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch:

M1100188

M

08-11-13 (X)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/10/2008 4:21:23 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43083

Part Number: D205634041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

20.0	AN960JD10L	Washer
------	------------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: M105793

JW

21.0	ALS71032130	Insert
------	-------------	--------



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

Insert

Batch: M105819

* JW

22.0	AN3C4A	BOLT
------	--------	------



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

BOLT

Batch: M109431

JW

23.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

washer

Batch: M109752

JW

24.0	D356613	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B41862

JW

25.0	D35665	Gasket
------	--------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B41467

JW

26.0	D35661	Gasket
------	--------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

GASKET

Batch: B42237

JW

08-11-13

(V)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/10/2008 4:21:23 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43083

Part Number: D205634041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

27.0	D356413	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1341933

JK

28.0	D356411	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1342248

JK

29.0	D35649	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1342258

JK

30.0	D35645	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 1342236

JK

31.0	D25943	O-Ring, 205 Skidtube
------	--------	----------------------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: 1329908

JK

32.0	D25941	Plug, 205 Skidtube
------	--------	--------------------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: 1340153

JK

33.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R Sikaflex-291 M 109449

JK 08-11-13 *X(1)*

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 29/10/2008 4:21:23 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43083

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

✓ Sikaflex expire date: 08/11

✓ 2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

✓ 3-Inspect for foreign object per QSI 024

✓ 4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 M109449
✓ Sikaflex expire date: 08/11

08-11-13 (X)

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch: M109219

- F2 08/11/13 (1)

34.0

QC5

INSPECT WORK TO CURRENT STEP



08-11-13 (1)

Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

35.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location: ID

PPP Rev: ID

08/11/13 (1)

36.0

QC21

FINAL INSPECTION/W/O RELEASE



08/11/14 HJ

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF 08-11-14

B43083

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries



DESIGN #	DRAWN BY RH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

RELEASED
07-06-28 #

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
SEE NOTES ON
PAGE 2 FOR D2580-041 AND
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 43083

Copyright © 1996 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

RELEASED
07-06-28

Diagram illustrating the grinding locations for the D2576-3 step. The diagram shows a cross-section of the component with the following labels:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- LOCATION RIDGE ON UNDERSIDE OF D2576
- $\frac{1}{16}$

Diagram illustrating the assembly of a bolted joint. The components and dimensions are labeled as follows:

- DRILL PRIOR TO D2855 CAP INSTALLATION (2 PLACES)
- AN3-5A BOLT (1)
- AN960J10L WASHER (1)
- D2855 CAP
- SEAL WITH SIKAFLEX-241/-291
- 0.208
- 0.40
- UNC
- SUB

D2579 SPACER

WEB (REF)

130 (REF)
0 PLACES

AFTER PERFORATION

1. CHASE
2. INSIDE
3. WELL
4. C.B.

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

37.50
DISTANCE TO AFT END
OF D2596 WEB

3
7

1.750 1.750

#0.508 (TYP.)
(40 PLACES)

REFER TO DETAIL A

8.750

17.375

26.000

34.188

57.313 (REF)
7 EQUAL SPACES
8.188 PITCH

38.0

91.500

190.0
(D2500-1)

REFER TO DETAIL A

0.5 1.5 1.5

BLACK ANTI-SKID TO 0.5 ABOVE LOCATION RIDGE

BLACK ANTI-SKID TOP OF STEP TO 0.5 ABOVE BOTTOM EDGE

WELD AS PER DETAIL B

REFER TO DETAIL C

D3566-1 D3566-5 D3566-1 D3566-13

D3564-11 D3564-5 D3564-9 D3564-13

AN3C4A BOLT (1)
AN560C10L WASHER (1)
(50 PLACES)

DESIGN DRAWN BY CHECKED BY

COPYRIGHT © 1998 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

07.02.27

DART

DART AEROSPACE LTD.
HAMPSHIRE, ONTARIO, CANADA

	DRAWING NO.
--	-------------

D2580

TITLE

205 SKIDTUBE ASSEMBLY

REV. D

SHEET 2 OF 3

1:24

RELEASED
07 Dec 78

Diagram illustrating the grinding locations for the propeller cross-section. The diagram shows a cross-section of a propeller with the following labels:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- LOCATION RIDGE ON UNDERSIDE OF D2576

Diagram illustrating the rear view of the engine block assembly, showing the installation of the D2855 cap and AN3-5A bolt.

Labels and dimensions:

- DRILL PRIOR TO D2855 CAP INSTALLATION (2 PLACES)
- SEAL WITH SIKAFLEX-241/-291
- AN3-5A BOLT (1)
- AN960JD10L WASHER (1)
- D2855 CAP
- SEE NOTE ii)
- 0.40

D2579 SPACER

WEB (REF)

-130 (REF)

0 PLACES

AFTER PERFORM

1. CHA
2. INS
3. WE
4. C'B

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

ii) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

37.50
DISTANCE TO AFT END
OF D2596 WEB

3
7

1.750 1.750

0.508 (TYP.)
(40 PLACES)

REFER TO DETAIL E

REFER TO DETAIL A

8.750

17.375

26.000

34.188

57.313 (REF)
7 EQUAL SPACES
8.188 PITCH

38.0

91.500

190.0
(D2500-1)

(MAKE FROM D2580-1 DRILLING DETAIL)

5.985

5.338 (REF)

51.340

39.580

5.915

3.630 (REF)

Ø0.508 (8 PLACES)

Ø0.640

20.0

1.4

1.0

1.0

13.4

32.0 ± 1.0

11

4

4

4

DISTANCE BETWEEN HOLE AND TANGENT POINT

DISTANCE BETWEEN HOLE AND TANGENT POINT

0.5

REFER TO DETAIL G

NO C'BORE NO PLUG

1.5

1.5

H

BLACK ANTI-SKID TO 0.5 ABOVE LOCATION RIDGE

NO C'BORE NO PLUG

8

1.5

1.5

1.5

BLACK ANTI-SKID TOP OF STEP TO 0.5 ABOVE BOTTOM EDGE

WELD AS PER DETAIL F

NO C'BORE NO PLUG

D3566-1

D3566-5

D3566-13

D3564-11

D3564-5

D3564-9

D3564-13

AN3C4A BOLT (1)

AN960C10L WASHER (1)

(50 PLACES)

DESIGN	DRAWN BY

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

PH
CHECKED HA
DATE 07.02.27

APPROVED *[Signature]*

DRAWING NO.
D2580

REV. D
SHEET 3 OF 3

02800	TITLE
	205 SKIDTUBE ASSEMBLY

REV. D
3 OF 3
SCALE
1:24

NO. 173

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliott
Job number: 41315 A0
Part number: D204 635041
Description: 204/205 stud tube
Welding Process: Tig[☒] Mig[]
Base material: Aluminium
Current: AC[☒] DC[]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[]
Penetration: pass[☒] fail[]

UNACCEPTABLE

Cracks: pass[☒] fail[]
Undercut: pass[☒] fail[]
Pin holes: pass[☒] fail[]
Overlap (cold lap): pass[☒] fail[]
Porosity (surface): pass[☒] fail[]
Coloration: pass[☒] fail[]

Qualifier Pat Duval Date of Test Coupon 08-09-24
Welder Barclay Elliott Date of Test Coupon 08-09-24

The above named individual is qualified in accordance with AWS D17.1.2001 to weld